

POWER STEERING SERVICE TIPS PREVENT PROBLEMS BEFORE THEY OCCUR

WARNING: FAILURE TO CLEAN AND FLUSH THE POWER STEERING SYSTEM MAY VOID YOUR WARRANTY

POWER STEERING COMPONENTS MAY RETAIN CONTAMINATION

When replacing only one component in the power steering system, other components may retain exiting contamination that must be Removed from the system. Failure to do so may potentially cause damage to the new installed component. Contamination can cause a rack to leak or a pump to make noise as well as malfunction in terms of creating desired levels of pressure.

EXAMINING THE FLUIDS FROM THE PS SYSTEM CAN ASSIST IN DIAGNOSING OTHER COMPONENT ISSUES


Before replacing a steering rack or pump, it is important to examine the fluid currently in the power steering system. Remove a small sample of fluid through the rack return hose and place in dark waste container. Let fluid sample settle before continuing with examination. Using a flashlight, shine light directly into the fluid sample. If the fluid sample contains any metal shaving contamination, this is a direct result of a failing power steering pump and therefore the pump should be replaced at the same time a new rack is installed. If the fluid sample contains small fragments of rubber, this is an indication that the PS hoses are experiencing deterioration and should be replaced. If the fluid has a dark appearance or strong burnt odor, these are also indicators that the pump has been run low of fluid and has potentially been damaged.

REPLACE THE HOSES

Check ALL the power steering hoses. If you spot a leak, or if the hose feels stiff or spongy–**REPLACE ALL THE HOSES** in the system. Here's why: The hoses are all made from similar compounds. If one hose is rotted, it is a sure sign that ALL hoses are probably rotted. Not only is a deteriorated hose unsafe, but it will retain residue which contaminates the new rack and/or pump and causes malfunctions.

ALWAYS FLUSH THE SYSTEM

- 1. Disconnect the pressure hose from the rack and place into a waste container. Disconnect the return hose from the pump and place into a waste container. Plug the pump inlet connector port.
- 2. Fill the pump reservoir with recommended power steering fluid for your vehicle.
- 3. While another person continues to fill the reservoir, turn over the engine in very short burst. DO NOT ALLOW the pump to run without fluid as this will cause damage to the part. Repeat this cycle until the fluid coming from the pressure hose is clear and contamination free.
- 4. Reconnect the pressure hose to the rack. Remove the inlet connector port plug and reconnect the return hose to the pump.
- 5. Refill the reservoir with the appropriate recommended fluid. DO NOT RECYCLE or REUSE the old fluid used to flush the system.
- 6. While another person continues to fill the reservoir, crank the engine and cycle the steering wheel from left lock to right lock position several times with the wheels not in contact with the ground. Add additional fluid as needed while cycling the steering wheel. The system is self-bleeding and after continuous cycles, all air within the system should be removed. Inspect reservoir fluid for bubbles or noise coming from the system. Continue to purge the system until all bubbles or noise are gone.
- 7. Do not over fill reservoir. Replace reservoir cap once system has been properly filled.

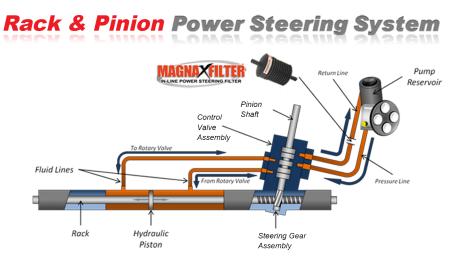

The information supplied in this document is for informational purposes only. We have made every effort to assure the accuracy of the provided information and assume no responsibility for any loss or damage due to errors or omissions or to the use or misuse of any information supplied. © CRP Industries Inc. All rights reserved.

TECH HELP HOTLINE: 1-800-654-7565

www.aaesteering.com

AAETIPS02ENG

© CRP Industries Inc. All rights reserved.



NOTICE

CORE RETURN POLICY

The Following Items MAY Render a Core Non-Rebuildable:

- Bent or Broken Bar
- Stripped Threads or Ports
- Cracked or Broken Mounts
- Cracked or Broken Housing
- Heavy Rust (subject to inspection)
- **Missing Parts** (possible partial credit for missing parts based on replacement cost)
- Damaged or Missing Variable Speed Sensors
- Cut or Missing Hard Fluid Lines (subject to inspection)
- Bent / Missing / Damaged Inner Tie Rods (subject to inspection)
- Stripped / Damaged Pinion Splines (subject to inspection)

NO CREDIT WILL BE GIVEN FOR DAMAGED NON-REBUILDABLE CORES!

TECH HELP HOTLINE: 1-800-654-7565

www.aaesteering.com

AAECRP02ENG